

# Invoice

Date	Invoice #
1/3/2018	1397

Bill To
Alan Estrada 733 Grayson Road Pleasant Hill, CA, 94523

Ship To
1974 BMW 3.5 CS

P.O. Number	Terms	Rep	Ship	Via	F.O.B.	Project
			7/1/2018			
Quantity	Item Code	Description			Price Each	Amount
7	62-60-500	Develop optimal location for second AFR O2 sensor position, install sensor in secondary exhaust.			130.00	910.00
4.25	61-21-011	Battery, main, test function, remove and replace defective unit, build new positive terminal, auxiliary power supply lead.			130.00	552.50
4.75	11-34-006	Valve lash, check and correct, S14/S38.			130.00	617.50
8.5	11-31-100	Test intake and exhaust cam timing, valve lift, validate TDC reference on flywheel(crankshaft damper indicator is incorrect.			130.00	1,105.00
9.5	13-60-800	Diagnose cause of short circuit in fuel injector wiring. Remove faulty wiring harness, terminate constant power supply. Build fuel injector wiring harness.			130.00	1,235.00
12.75	12-11-031	Crank position sensor wiring harness has intermittent connections, remove faulty harness and build new harness.			130.00	1,657.50
13.5	13-60-200	Build ECU power supply circuit; mount, relay, power and ground harnesses.			130.00	1,755.00
1	12-13-009	Test ignition coil circuit operation.			130.00	130.00
2.5	12-13-010	Build primary ignition coil circuit, remove incorrect ignition coil, install correct coil.			130.00	325.00
1.75	13-31-029	Test fuel pump operation.			130.00	227.50
6.5	13-31-200	Build power supply circuit to fuel pump.			130.00	845.00
5.75	61-31-022	Build switched power supply to main relay from ignition switch.			130.00	747.50
1.75	13-60-509	Test ECU, primary ignition, fuel pump, power and ground circuit operation.			130.00	227.50
5.5	13-63-029	Test throttle position switch operation, diagnose malfunction, revise wiring harness for throttle position switch.			130.00	715.00
7.25	61-31-281	Test oil pressure warning circuit. Rectify mounting fitting installation, install oil pressure sensor, build input circuit to ECU, restore warning light operation.			130.00	942.50
1	12-13-1-286-087	Ignition coil, E28/S38B35.			123.56	123.56T
2	12-63-1-708-647	Relay, main, fuel system, w/diode, E24/S38.			52.99	105.98T
1	61-36-1-729-004	Relay, main			28.77	28.77T
1	61-13-1-358-603	Boot, 3 pin connector.			7.37	7.37T
1	12-52-1-706-096	Connector, 3-pin, w/pigtail.			29.81	29.81T
6	12-52-1-706-091	Connector, 2-pin, w/pigtail.			9.67	58.02T
					Total	

# Invoice

Date	Invoice #
1/3/2018	1397

Bill To
Alan Estrada 733 Grayson Road Pleasant Hill, CA, 94523

Ship To
1974 BMW 3.5 CS

P.O. Number		Terms	Rep	Ship	Via	F.O.B.	Project	
				7/1/2018				
Quantity	Item Code	Description				Price Each	Amount	
6	61-13-1-358-330	Boot, 2-pin connector.				8.84	53.04T	
1	61-31-1-354-274RR	Pressure sensor, 150 PSI, 1/8-27 NPT.				136.63	136.63T	
92.25	00-00-000	Shop rate discount.				-65.00	-5,996.25	
		Sales Tax				8.625%	46.85	
							</	