

I hereby authorize the repair work listed herein to be performed by La Jolla Independent, Inc. ("LJI"). I authorize LJI employees to operate my vehicle for the purposes of inspection or delivery, at my risk. An express lien is acknowledged on said vehicle to secure the amount of repairs thereto. I will not hold LJI responsible for loss or damage to vehicle or its contents in case of fire, theft, accident or any other cause beyond LJI's control. I agree to pay all collection costs and/or attorney's fees in the event that default is made in any payment due. If vehicle is returned to me without repair service being performed, a diagnostic and handling fee (including reassembly) may be charged. In addition, my signature at the bottom of the final invoice will denote approval and ratification of all increases over original estimate if my oral authorization is given, comport w/Cal. B & P section 9884.9(b)(2). I have read and understand the above and acknowledge receipt of an estimate.



X

VEHICLES LEFT ON THE PREMISES 48 HOURS AFTER COMPLETION OF THE AUTHORIZED REPAIR WILL BE SUBJECT TO A \$50/DAY STORAGE FEE

Invoice # 53787

Scott Jordan
Po Bx 2626
Ketchum, ID 83340

(208) 720-6085

1974 BMW 3.0CS

VIN: 4310050
Engine: L6 3.0L, 182cid, SOHC, GAS, CARB
Trans: 5

License # MY BABY
ODO In: 118965 Out: 118965
Color: Sch
Mfg. Date:

Unit #

Inv Date: 10/22/2024 @ 8:38am

Service Writer: Carl Nelson
Status: Posted
Driver: Jordan, Scott
PO #
Key Tag / Hat #

Vehicle Problems	Requests for Service	Services Performed	Hrs	Qty	Price	Disc.	Ext
Requests for Service & Vehicle Problems -							
	Labor Service - Check and advise, car has had significant rust patch (poor), 1974 came with no rear sway bar, rec big bar kit. Left door brake missing, hood prop in sad shape, batt hold down broken, engine fan is hard mount, swithc to late fan clutch, trans mount collapsed, underbody could use thorough cleaning, front brakes are bound, rear drag. start with hoses, may need caliper rebuild, both fuel pipes rusted and spliced rec new pipes. h/b adj and grommets Car has original 3.0 block. runs well, boro scope cylinder walls, heavy scoring, = oil consumption SJ, CN		1.00		150.00		150.00
	<i>New 61-13-1-363-318</i>	<i>Alt pig cover</i>		1.00	9.25		9.25
	<i>New 61-31-1-356-193</i>	<i>Hazard 8 w/resist 08/73<</i>		1.00	112.50		112.50
	<i>New 51-71-1-810-531</i>	<i>Hood Seal E9 INT</i>		1.00	107.28		107.28
	<i>New 07-12-9-925-707</i>	<i>Bodynut e3/9 gril 3.9</i>		4.00	1.21		4.84
	Labor Service - Remove and replace door brake, check operation SJ		1.50		150.00		225.00
	<i>New 51-21-6-650-054</i>	<i>Pin door brake 5mm 2002</i>		1.00	6.38		6.38
	Labor Service - Remove and replace hood prop, weld repair, replace end blocks JP		3.00		150.00		450.00
	<i>New 41-61-5-480-146</i>	<i>Hood prop block 02/e3/9 ear sq</i>		2.00	75.67		151.34
	<i>New 51-23-5-480-142</i>	<i>J tab NLA SS</i>		2.00	20.00		40.00
	Labor Service - drill and inset battery hold down SJ		0.50		150.00		75.00
	Labor Service - Remove and replace front and rear brake hydraulic hoses, bleed brake fluid and test SJ		3.00		150.00		450.00
	<i>New LMA DOT 4</i>	<i>Brake fluid (pint)</i>		3.00	7.50		22.50
	<i>New 34-32-1-159-878</i>	<i>Brake hose rear 02/cs/e9/21</i>		2.00	91.55	-125.10	58.00
	<i>New 34-32-1-159-879</i>	<i>Brake hose ft 02/e3/9/12/21</i>		4.00	134.71	-434.84	104.00
	<i>New 34-33-1-151-533</i>	<i>check valve brake booster most</i>		1.00	43.43	-7.43	36.00
	<i>New 34-32-6-755-588</i>	<i>Pipe 685mm</i>		1.00	30.45		30.45
	<i>New 34-34-1-163-565</i>	<i>Clip brake line</i>		2.00	1.85		3.70
	Labor Service - Strut mounts front remove and replace SJ		2.00		150.00		300.00
	<i>New CAMBER - PAIR</i>	<i>Reverse camber plate</i>		1.00	85.00		85.00
	Labor Service - Mount and balance four tires FH		1.00		150.00		150.00
	<i>New WHEEL WEIGHT</i>	<i>Wheel weights misc sizes</i>		8.00	2.00		16.00
	Labor Service - Sublet exhaust work, sub hanson SJ		1.00		575.00		575.00
	<i>New STAHL</i>	<i>Stahl e9 1 3/8 recond</i>		1.00	1,500.00		1,500.00
	Labor Service - Remove and replace coolant hoses and bleed cooling system and test CS		3.00		150.00		450.00
	<i>New 11-53-1-266-459</i>	<i>Hose t hsg-w\pump 6</i>		1.00	32.10		32.10
	<i>New 11-53-1-266-509</i>	<i>Hose ther ft int man bav</i>		1.00	31.03		31.03
	<i>New 11-53-1-266-510</i>	<i>Hose betw carb bav</i>		1.00	27.75		27.75
	<i>New 11-53-1-266-508</i>	<i>Hose E3/9 exp tank to int diag</i>		1.00	56.58		56.58
	<i>New 11-53-1-266-462</i>	<i>Rad Hose e3/9/12 lower rad</i>		1.00	39.26		39.26
	<i>New 17-11-1-150-232</i>	<i>Hose coolant overflow 7mm 1.0</i>		1.00	15.15		15.15
	<i>New 11-53-1-266-467</i>	<i>rad hose e9 csi upper</i>		1.00	50.58		50.58
	<i>New CLAMPS</i>	<i>Hose clamps misc sizes</i>		16.00	2.10		33.60
	<i>New 17-12-1-712-736</i>	<i>Hose 8mm coolant</i>		1.00	71.94	-40.94	31.00
	<i>New 07-11-9-909-704</i>	<i>plug t-stat hsg 14x1.5</i>		1.00	3.09		3.09
	Labor Service - Remove and replace accelerator pedal bushings SJ		1.50		150.00		225.00
	<i>New 35-41-4-640-194</i>	<i>Bushing</i>		2.00	8.04		16.08

I hereby authorize the repair work listed herein to be performed by La Jolla Independent, Inc. ("LJI"). I authorize LJI employees to operate my vehicle for the purposes of inspection or delivery, at my risk. An express lien is acknowledged on said vehicle to secure the amount of repairs thereto. I will not hold LJI responsible for loss or damage to vehicle or its contents in case of fire, theft, accident or any other cause beyond LJI's control. I agree to pay all collection costs and/or attorney's fees in the event that default is made in any payment due. If vehicle is returned to me without repair service being performed, a diagnostic and handling fee (including reassembly) may be charged. In addition, my signature at the bottom of the final invoice will denote approval and ratification of all increases over original estimate if my oral authorization is given, comport w/Cal. B & P section 9884.9(b)(2). I have read and understand the above and acknowledge receipt of an estimate.



X

VEHICLES LEFT ON THE PREMISES 48 HOURS AFTER COMPLETION OF THE AUTHORIZED REPAIR WILL BE SUBJECT TO A \$50/DAY STORAGE FEE

Invoice # 53787

Scott Jordan		1974 BMW 3.0CS		License # MY BABY	Inv Date: 10/22/2024 @ 8:38am	
New	35-41-1-119-306	Return spring		1.00	19.43	19.43
Labor Service - alignment sublet				0.75	150.00	112.50
Labor Service - 91				1.00	150.00	150.00
Labor Service - remove and replace SJ				2.00	150.00	300.00
Labor Service - REBUILD CALIPER (2)				2.00	225.00	450.00
Labor Service - REBUILD CALIPER (2)				2.00	180.00	360.00
Labor Service - Flush brake fluid from brake hydraulic system and test SJ				1.40	150.00	210.00
Labor Service - Adjust rear drum brakes. SJ				0.35	150.00	52.50
Labor Service - Repair broken/burnt wiring harness., lic lights and rear TK				1.00	150.00	150.00
Labor Service - Remove and replace carb CS				4.00	150.00	600.00

The Transmission needs a standard maintenance service.

Labor Service - Sublet/driveshaft/custom				1.00	575.00	575.00
New	26-11-1-107-832	Flex disc 12mm cs/bav		1.00	278.79	-163.79
Labor Service - Remove and replace 5 peed swap, fabricate shift plat and mounts SJ				6.00	150.00	900.00
New	SS HOSE E9/5 DOWN	Clutch hose 5 spd e3/9 down master		1.00	49.00	49.00
New	21-51-1-202-659	pivot early bronze		1.00	30.00	30.00
Used	25-11-1-205-386	Shift platform 5 6 NLA		1.00	163.00	163.00
New	25-11-1-202-842	Shift tower mount 262/265		2.00	76.70	-111.40
New	23-41-1-200-936	Shift insulation cs		1.00	42.09	42.09
New	25-11-1-220-539	Shifter rod		1.00	47.35	47.35
New	25-11-7-571-899	Super Clip Large		2.00	2.12	4.24
New	25-11-7-501-309	Shift joint long		1.00	81.00	81.00
New	21-21-9-069-01X	Clutch kit m30		1.00	917.00	-317.00
Used	23-00-1-208-727U	Trans 265/6 m30 od5 used NLA		1.00	3,755.00	-1655.00
New	25-11-1-434-194	Foam pad shift joint		1.00	3.55	3.55
New	25-11-1-220-439	Shim selector rod yellow		2.00	2.65	5.30
New	23-71-1-175-314	Carrier e12/5		1.00	108.50	108.50
New	23-71-1-109-173	Trans mount e21 >8/79		1.00	22.63	22.63
Used	23-00-1-209-490	Trans 262/9 m30 4spd		-1.00	4,136.00	-3936.00
Used	25-11-7-527-255	Shift lever e36/46/39 M cars		1.00	162.86	162.86
New	25-11-1-221-243	o-ring 10x2.2		2.00	3.57	7.14
New	25-11-1-207-744	Cup shifter		1.00	5.63	5.63
New	83-22-0-309-031	MTF 2 75/80		2.00	43.32	-44.64
New	11-42-1-436-982	Oil filter housing mount m62		1.00	23.27	23.27
Labor Service - Remove and replace speedometer cable SJ				1.00	150.00	150.00
New	62-12-1-810-624	Speedo cable e9 5spd/auto		1.00	118.50	118.50
Used	23-21-1-207-772	Speedo drive getrag 262/265 NLA		1.00	155.00	155.00
New	23-22-1-490-119	Gear speedo drive 6 cyl		1.00	203.33	203.33

The engine needs a complete rebuild.

Labor Service - Parts Sold					150.00	0.00
New	11-13-1-315-085	Oil pan gsk m30 early		1.00	21.55	-5.39
New	11-12-1-730-935	Vcg m30 early		1.00	35.06	-5.26
New	11-14-2-245-364	Crankshaft seal m10/20/30/50 rear 8 bolt		1.00	40.83	-10.21
New	07-11-9-901-301	Nut oil pump m10/30 NLA		1.00	5.50	5.50
New	07-11-9-932-634	Washer oil pump m10/30 NLA		1.00	2.00	2.00
New	11-24-1-284-550 6C	Rod brg set m30 std		1.00	555.72	-345.72
New	11-21-1-261-033	Main brg set m30 std		1.00	1,092.00	-777.00
New	11-14-1-735-047	Timing cover gasket m30 [set]		1.00	45.74	45.74
New	11-31-1-262-273	Tensioner Rail M10/30		1.00	61.89	-12.38
New	11-31-1-253-236	Timing chain rail m10/30		1.00	9.84	9.84
New	11-31-1-716-986	Timing chain m10/30 single row		1.00	70.24	-18.24
New	11-14-1-250-073	Gasket rear cover m30 (crank)		1.00	3.98	3.98

I hereby authorize the repair work listed herein to be performed by La Jolla Independent, Inc. ("LJI"). I authorize LJI employees to operate my vehicle for the purposes of inspection or delivery, at my risk. An express lien is acknowledged on said vehicle to secure the amount of repairs thereto. I will not hold LJI responsible for loss or damage to vehicle or its contents in case of fire, theft, accident or any other cause beyond LJI's control. I agree to pay all collection costs and/or attorney's fees in the event that default is made in any payment due. If vehicle is returned to me without repair service being performed, a diagnostic and handling fee (including reassembly) may be charged. In addition, my signature at the bottom of the final invoice will denote approval and ratification of all increases over original estimate if my oral authorization is given, comport w/Cal. B & P section 9884.9(b)(2). I have read and understand the above and acknowledge receipt of an estimate.



X

VEHICLES LEFT ON THE PREMISES 48 HOURS AFTER COMPLETION OF THE AUTHORIZED REPAIR WILL BE SUBJECT TO A \$50/DAY STORAGE FEE

Invoice # 53787

Scott Jordan

1974 BMW 3.0CS

License # MY BABY

Inv Date: 10/22/2024 @ 8:38am

New	11-12-1-726-725	Gasket rear cover m30 (head)	1.00	4.63		4.63
New	11-21-1-468-742	Pilot bearing ball type (32mm)	1.00	13.68	-2.68	11.00
Used	11-31-1-744-347	Tensioner piston M10/30 NLA	1.00	41.27		41.27
New	61-31-1-354-274	Oil press sw early 12x1.5	1.00	26.41	-6.60	19.81
New	11-31-1-250-092	O-ring distributor drive	1.00	10.95		10.95
Used	11-00-1-717-482U	Engine 3.5 late 9.5:1 use	1.00	4,695.00	-2895.00	1,800.00
New	COOLANT 50/50	Antifreeze 50/50 mixture	2.00	30.68		61.36
New	20/50 MOTOR OIL	Motor oil	13.00	5.20		67.60
New	11-42-9-063-138	Oil filter m30 77< ox41d	2.00	24.67	-15.34	34.00
New	11-25-1-714-383	Ring set m30 3.5 std	6.00	88.66	-117.96	414.00
New	11-25-1-276-701	Piston 92.00 3.5 10.0:1 >88	6.00	249.59		1,497.54
New	11-41-1-716-988	Oil pump chain m30 >86 46 link thick	1.00	85.03	-25.51	59.52
New	35-41-1-100-674	Throttle bush tii/e3/9/12/24	2.00	2.60		5.20
New	11-52-1-723-918	Fan clutch 000 screw on most	1.00	186.75	-37.75	149.00
New	11-52-1-271-846	Fan blade 9 blade e3/9/23	1.00	104.51	-33.51	71.00
New	18930.020	weber 38/38 DGAS ele choke	2.00	779.00	-768.00	790.00
New	11-61-9-065-674	Water box gsk m30 int	2.00	16.75		33.50
New	11-51-1-720-893	Water pump m30 screw on	1.00	323.00	-213.00	110.00
New	62-11-1-268-355	Temp sender most	1.00	40.03	-10.01	30.02
Rebuilt	12-41-1-466-093	Sr-95-x m30 >5/87 NLA	1.00	528.56	-233.56	295.00
New	12-12-1-267-485	Wr7dc plug most early	6.00	25.78	-118.68	36.00
New	11-53-1-266-459	Hose t hsg-w/pump 6	1.00	32.10		32.10
New	11-53-1-266-462	Rad Hose e3/9/12 lower rad	1.00	39.26		39.26
New	11-53-1-266-510	Hose betw carb bav	1.00	27.75		27.75
New	22680.051B	Weber 32/36 dgav water	-2.00	659.90	-1119.80	-200.00
New	43928.060	Weber idle cut off 8x1.25	2.00	46.70	-15.40	78.00
New	13-71-1-284-260	Seal carb to air cleaner	2.00	5.38		10.76
New	11-15-1-276-485	Breather hose e28 m30	1.00	9.56	-2.26	7.30
New	13-73-1-254-874	Hose air 70mm	1.00	21.82		21.82
New	13-72-1-256-410	Air filter 02/e3/9 (2)	2.00	23.39		46.78
New	TUNE+-6-R-V-BMW	123 distributor M30 carb, bluetooth	1.00	650.00		650.00

Labor Service - sublet machine shop sub, mw21087clean hone deck polish crank pin bush valve job guides seatssurface 1.00 1,900.00 1,900.00

Labor Service - Remove and replace engine and related parts, pull (3) FH 12.00 150.00 1,800.00

Labor Service - Rebuild engine SJ 18.00 150.00 2,700.00

New PAINT B Paint prep products misc 1.00 50.00 50.00

Add On Charges Breakdown

Haz. Materials 8.00

Vehicle Tire Information

Check Performed.

	Left Front	Right Front	Left Rear	Right Rear	Checked By
Tire Pressure PSI	35	35	35	35	

I hereby authorize the repair work listed herein to be performed by La Jolla Independent, Inc. ("LJI"). I authorize LJI employees to operate my vehicle for the purposes of inspection or delivery, at my risk. An express lien is acknowledged on said vehicle to secure the amount of repairs thereto. I will not hold LJI responsible for loss or damage to vehicle or its contents in case of fire, theft, accident or any other cause beyond LJI's control. I agree to pay all collection costs and/or attorney's fees in the event that default is made in any payment due. If vehicle is returned to me without repair service being performed, a diagnostic and handling fee (including reassembly) may be charged. In addition, my signature at the bottom of the final invoice will denote approval and ratification of all increases over original estimate if my oral authorization is given, comport w/Cal. B & P section 9884.9(b)(2). I have read and understand the above and acknowledge receipt of an estimate.



X

VEHICLES LEFT ON THE PREMISES 48 HOURS AFTER COMPLETION OF THE AUTHORIZED REPAIR WILL BE SUBJECT TO A \$50/DAY STORAGE FEE

Invoice # 53787

Scott Jordan

1974 BMW 3.0CS

License # MY BABY

Inv Date: 10/22/2024 @ 8:38am

Continued from previous page

<p>Warranty Installation of new parts purchased through La Jolla Independent, Inc. are warranted for 2 year or 24,000 miles from service date. No warranty, expressed or implied on the installation of used or "customer supplied" parts.</p>	<p>Posted 11/18/25 6:02PM American Express 22,117.60 Credit Applied 5,000.00</p>	<p>Invoice Summary</p> <table border="0"> <tr> <td>Parts</td> <td>13,649.60</td> </tr> <tr> <td>Labor</td> <td>13,460.00</td> </tr> <tr> <td>Add On Charges</td> <td>8.00</td> </tr> <tr> <td>Sub Total</td> <td>27,117.60</td> </tr> <tr> <td>Sales Tax (OOS)</td> <td></td> </tr> <tr> <td>Total</td> <td>27,117.60</td> </tr> </table>	Parts	13,649.60	Labor	13,460.00	Add On Charges	8.00	Sub Total	27,117.60	Sales Tax (OOS)		Total	27,117.60
Parts	13,649.60													
Labor	13,460.00													
Add On Charges	8.00													
Sub Total	27,117.60													
Sales Tax (OOS)														
Total	27,117.60													
<p>X</p> <p>Consumer acknowledges receipt of goods and/or services in the amount shown hereon and agrees to perform the obligations set forth by the card member's agreement with the issuer</p>	<p>Original Estimate: 150.00</p>	<p>Total 27,117.60</p>												